

		<ul style="list-style-type: none"> position sensor A circuit: short circuit to ground • Turbocharger boost control position sensor A circuit: open circuit • Turbocharger fault 	<p>Install a new turbocharger if necessary. REFER to: Turbocharger (303-04B Fuel Charging and Controls - Turbocharger - 2.4L Duratorq-TDCi HPCR (103kW/140PS) - Puma, Removal and Installation). Clear the DTCs and test for normal operation.</p>
P256373	Turbocharger boost control position sensor A circuit range/performance - actuator stuck closed	<ul style="list-style-type: none"> • Turbocharger boost control position sensor A circuit: short circuit to power • Turbocharger boost control position sensor A circuit: short circuit to ground • Turbocharger boost control position sensor A circuit: open circuit • Turbocharger fault 	