

		position sensor A circuit: short circuit to ground • Turbocharger boost control position sensor A circuit: open circuit • Turbocharger fault	Install a new turbocharger if necessary. REFER to: <a href="#">Turbocharger</a> (303-04B Fuel Charging and Controls - Turbocharger - 2.4L Duratorq-TDCi HPCR (103kW/140PS) - Puma, Removal and Installation). Clear the DTCs and test for normal operation.
P256373	Turbocharger boost control position sensor A circuit range/performance - actuator stuck closed	• Turbocharger boost control position sensor A circuit: short circuit to power • Turbocharger boost control position sensor A circuit: short circuit to ground • Turbocharger boost control position sensor A circuit: open circuit • Turbocharger fault	