
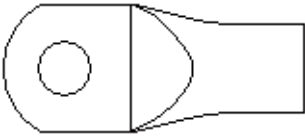


[Click here to print](#)  
Connector: **C3307**

Description: **Earth-Gearbox**  
Location: **LH side of gearbox**  
Qualifier:

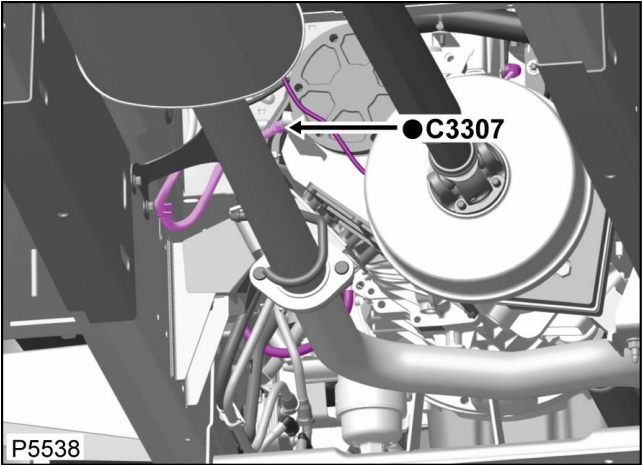

Part No.: **YPG800450**  
Colour: **TIN PLATED**  
Cavities: **IWY**  
  
Harness: **BATTERY NEGATIVE HARNESS**

Wire Chart

CAV	TERMINAL	CSA	COL	CCT	DESTN
I	-	50.0D	B	499	CI66I

Service Repair Kits

Refer to Harness Repair information

Se référer aux informations de réparation de faisceau

Siehe Informationen über Kabelbaumreparaturen



Vedere le informazioni che trattano le operazioni di riparazione del cablaggio

Remítase a la información sobre reparación de mazos de cables

Raadpleeg de informatie over kabelboomreparaties

Connector: **C3307**

Description: **Earth-Gearbox**  
Location: **LH side of gearbox**  
Qualifier:

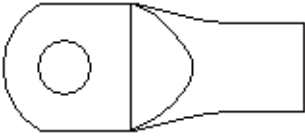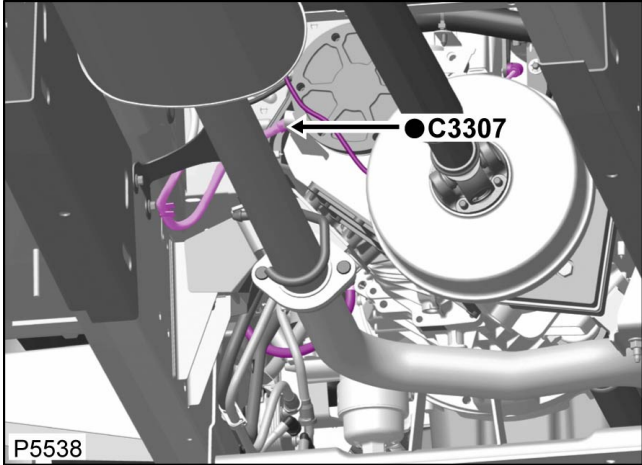

Part No.: **YPG800450**  
Colour: **TIN PLATED**  
Cavities: **IWY**  
  
Harness: **BATTERY NEGATIVE HARNESS**

Wire Chart

CAV	TERMINAL	CSA	COL	CCT	DESTN
I	-	50.0D	B	499	CI66I

Service Repair Kits

Refer to Harness Repair information

Se référer aux informations de réparation de faisceau

Siehe Informationen über Kabelbaumreparaturen