


[Click here to print](#)

Connector: **C1398**

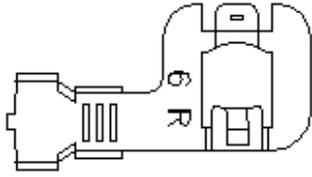

Part No.: **YPG800220**

Colour: **TIN PLATED**


Cavities: **IWY**

Harness: **MAIN LH + RH HARNESS**

Description: **Ground point**

Location: **Behind center of Instrument panel**

Qualifier:

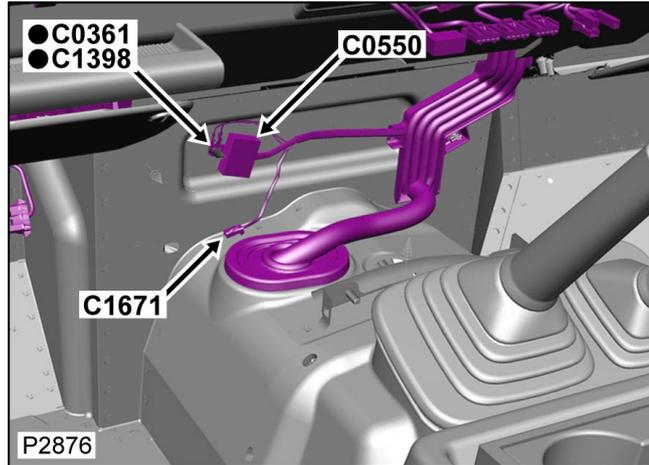


Wire Chart

CAV	TERMINAL	CSA	COL	CCT	DESTN
I	-	1.0D	B	22	C0488
I	-	1.5D	B	499	C0288

Service Repair Kits

Refer to Harness Repair information
Se référer aux informations de réparation de faisceau
Siehe Informationen über Kabelbaumreparaturen
Vedere le informazioni che trattano le operazioni
di riparazione del cablaggio
Remítase a la información sobre reparación de
mazos de cables
Raadpleeg de informatie over kabelboomreparaties

Connector: **C1398**

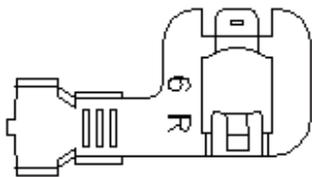

Part No.: **YPG800220**

Colour: **TIN PLATED**


Cavities: **IWY**

Harness: **MAIN LH + RH HARNESS**

Description: **Ground point**

Location: **Behind center of Instrument panel**

Qualifier:

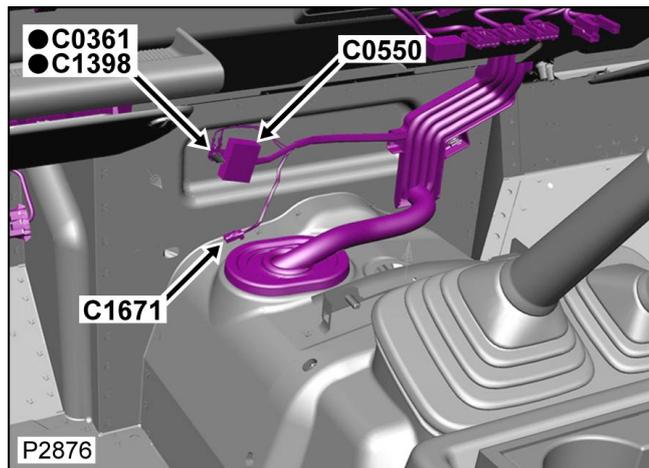

Wire Chart

CAV	TERMINAL	CSA	COL	CCT	DESTN
I	-	1.0D	B	22	C0488
I	-	1.5D	B	499	C0288

Service Repair Kits

Refer to Harness Repair information
Se référer aux informations de réparation de faisceau
Siehe Informationen über Kabelbaumreparaturen